


| CORNER No. | LOCATION | CALIFORNIA COORDINATES | ORIGINAL EVIDENCE FOUND | SUPPLEMENTAL EVIDENCE FOUND | NEW CORNER ACCESSORIES | REMARKS |
|------------|--------------------|----------------------------|---|--|---|--|
| 20 | 15 14 22 23 | 249,486.50 2,170,961.38 | No search made | G.L.O. B.C. in m.o.r. as per ⑥ | | G.L.O. resurvey cor. of 1939 was accepted as a perpetuated orig. corner |
| 30 | 1/4 15 14 | 252,020.76 2,170,761.38 | Root hole of SW Orig. BT 57°W 82'± Down 40" Tam S 19°E 100.0' | Definate Top of Ridge S 132'± | 18" R. Fir S 70°W 65.5' 11" R. Fir S 5°E 95.8' | Manu. set in 5'φ m.o.r. in talus slope. Exact position determined by best fit, noting that the dist. to the orig. SE BT is in error |
| 40 | 10 11 15 14 | 254,647.32 2,170,762.46 | None | Willow group S 70°±W 15'-17' 28" D. Fir w/o HB S 32°±E 39' Numerous rotten logs in area. All present trees badly curved. | 17" D. Fir N 40°W 91.0' 18" D. Fir N 27°E 85.0' 6" D. Fir S 14°W 78.5' 8" D. Fir S 8°E 74.8' | Exact corner position determined by D.P.M. using the topo calls for the "canon" to the E. & S., the topo call for the "ravine" to the N. and Cor. 30 |
| 49 | 16 15 21 22 | 249,264.56 2,165,708.41 | 24" Decayed stump N 61°W 13.0' 24" Fir w/ H.B. S 10°E 21.6' | Small m.o.r. | 12" Fir N 43°E 35.5' 10" Fir S 43°E 49.8' 16" Tam. S 16°W 28.7' 12" Fir N 62°W 30.1' | Exact corner position determined by best fit to orig. evidence fd. |
| 50 | 1/4 10 15 | 254,547.61 2,168,329.34 | None | Top of divide matching orig. topo call is West 50' to 60'± | 15" Tam. N 45°E 26.2' 12" Tam. S 57°W 97.3' | Established by record B. & D. from Cor. 60 because S.P.M. conflicts w/ topo. call. |
| 54 | 1/4 16 15 | 251,885.71 2,165,676.29 | Decomposed remains of B.T.s @ N 68°E 20'± & S 82°W 41'± | M.o.r. w/ rotten post Old K-tag on 40" Fir | 11" Fir S 81°E 28.2' 7" Fir S 70°W 43.2' | Exact manu. position set @ E. fd. m.o.r. |
| 60 | 9 10 16 15 | 254,534.16 2,165,692.08 | Rotten stump N 67°E 35.6' 38" Fir w/ open rotten blaze bears S 24°E 24.9' Rotten stump N 65°W 20.0' | 1" I.P. tagged L.S. 3202 in m.o.r. 20" Pine w/ H.B. on 4 sides bears N 50°E 53.4' | 20" Pine N 50°E 53.4' 12" Fir S 73°E 26.6' 7" Tam. S 27°W 86.7' 36" Fir N 16°W 135.0' | Manu. set over fd. I.P. |
| 69 | W.C. | | N.A. | N.A. | C.E. 1/16 Sec. 15 bears N 2°14'42"W 763.19' | W.C. set as C.E. 1/16 falls in lake |
| 70 | 1/4 15 22 | 249,392.52 2,168,329.26 | None | Rotten stump N 60°E 24.4' 30" R. Fir w/ chopped out blaze S 20°E 71' | 14" R. Fir N 26°W 16.2' 8" R. Fir S 9°E 36.8' | Corner accepted as a properly previously re-established corner |
| 71 | W 1/16 S 15 S 22 | 249,328.54 2,167,018.83 | N.A. | M.o.r. in vicinity | 12" R. Fir N 57°E 32.3' 14" R. Fir S 79°W 23.1' | |
| 72 | CW 1/16 S 15 | 251,920.94 2,167,002.80 | N.A. | do | 16" R. Fir N 46°W 38.6' 10" R. Fir S 10°E 24.2' | |
| 73 | C 1/4 S 15 | 251,956.17 2,168,329.30 | N.A. | do | 10" Tam. N 65°W 131.0' 8" Tam. S 81°E 140.1' | |
| 74 | W.C. | | N.A. | | C.E. 1/16 Sec. 15 bears N 88°28'43"E 791.05' | W.C. set as C.E. 1/16 falls in lake |
| 75 | SE 1/16 S 15 | 250,713.99 2,169,595.33 | N.A. | | 20" R. Fir East 52.0' 14" R. Fir N 35°W 60.0' | |
| 76 | S 1/16 S 15 14 | 250,753.63 2,170,861.38 | N.A. | | 10" Tam. N 44°E 92.6' 14" Tam. N 28°W 39.4' | |
| 77 | SS 1/64 S 15 14 | 250,120.07 2,170,911.38 | N.A. | | 8" Tam. N 22°E 14.5' 12" R. Fir S 42°W 58.5' | |
| 78 | CS-SE 1/64 S 15 | 250,076.75 2,169,620.32 | N.A. | | 14" R. Fir N 59°E 36.0' 14" R. Fir S 10°W 49.7' | |
| 79 | E 1/16 S 22 | 249,439.51 2,169,645.32 | N.A. | | 10" R. Fir N 43°W 100.8' 8" R. Fir S 24°E 27.1' | |
| 1054 | N 1/16 S 16 15 | 253,209.62 2,165,683.14 | N.A. | | 16" Fir N 19°E 19.5' 22" Fir S 55°W 35.2' | |

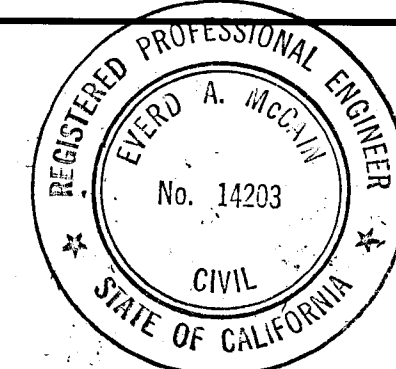

MCCAIN ASSOCIATES
CONSULTING ENGINEERS SURVEYORS

BRUNING 44-132