

<p>CORNER No. 2</p> <p>LS 2843 FD. AN ALUM. CAP ON A 5/8" REBAR PER (J)3. CORNER FALLS IN A FLAT AREA IN SCATTERED LARGE ROCKS.</p> <p>NO ACCESSORIES</p>	<p>WC 1.0' TO E 1/16 COR C—C S34 LS 4753 2003</p> <p>CORNER No. 12</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD FOR WITNESS CORNER, N 0° 51' 12" W, 1.0' FROM TRUE CORNER. CORNER FALLS 0.6' SOUTH OF FENCE UNDER THE EDGE OF A SHED.</p> <p>NO ACCESSORIES AVAILABLE</p>	<p>CORNER NOTES</p> <p>HB = HEALED BLAZE VS = VISIBLE SCRIBING BCIP = BRASS CAPPED IRON PIPE</p> <p>() 1 RECORD PER 5 R/S 110 () 2 RECORD PER 9 R/S 50 () 3 RECORD PER 10 PM 86 () 4 RECORD PER 4 R/S 86 () 5 RECORD PER 4 PM 92 () 6 RECORD PER 3 PM 9 () 7 RECORD PER 2 R/S 30 () 8 RECORD PER 11 R/S 141 () 9 RECORD PER 7 R/S 26 () 10 RECORD PER 3 R/S 71 () 11 RECORD PER 8 M 33 () 12 RECORD PER 8 R/S 92 () 13 RECORD PER 11 R/S 141</p>	<p>N 1/16 S31 LS 4753 2003</p> <p>CORNER No. 26</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. CORNER FALLS 5' NORTH OF A DIRT ROAD.</p> <p>SCRIBED A 15' PONDEROSA PINE, S44°E, 92.7' "N 1/16 S31 BT" SCRIBED AN 11" PONDEROSA PINE, N41 1/2°E, 82.5' "N 1/16 S31 BT"</p>	<p>T23N R14E 1/4 S32 S5 T22N LS 4753 2003</p> <p>CORNER No. 35</p> <p>NO EVIDENCE FD. SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD IN A MOUND OF STONE. CORNER FALLS ON A MODERATE EAST SLOPE, 170'± EAST OF THE TOP OF A SPUR.</p> <p>SCRIBED A 10" PONDEROSA PINE, S62°W, 17.4' "1/4 S5 BT" SCRIBED A 12" INCENSE CEDAR, N25°W, 24.8' "1/4 S32 BT"</p>
<p>C. BROWN CORNER No. 4</p> <p>RCE 22836 FD. A PLASTIC CAP IN A 3/4" IRON PIPE PER (J)3. CORNER FALLS 25'± NORTHEAST OF A PRIVATE ROAD.</p> <p>NO ACCESSORIES TIED</p>	<p>T23N R13E 1/4 S34 S35 LS 4753 2003</p> <p>CORNER No. 13</p> <p>FD. A 1 1/2" PIPE TAGGED RCE 7294 IN A MOUND OF STONE PER (J)4. SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD INSIDE PIPE. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE AT THE CORNER OF DELLEKER SUBDIVISION.</p> <p>FD. A 15" PONDEROSA PINE, N39°E, 7.2' -CHOPPED OUT FACE REC. A 12" PINE, N40°E, 6.8' (J)4 SCRIBED A 13" PONDEROSA PINE, N24°W, 12.9' "1/4 S34 BT"</p>		<p>NE 1/16 S31 LS 4753 2003</p> <p>CORNER No. 27</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. CORNER FALLS ON A GENTLE NORTHEAST SLOPE IN THINNED TIMBER.</p> <p>SCRIBED A 15" PONDEROSA PINE, N75 3/4°E, 79.0' "NE 1/16 S31 BT" SCRIBED A 12" PONDEROSA PINE, S7 1/4°W, 122.5' "NE 1/16 S31 BT"</p>	<p>T23N S32 S33 T22N S5 S4 R14E LS 5623 1997</p> <p>CORNER No. 36</p> <p>FD. A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD IN A MOUND OF STONE PER (J)13. CORNER FALLS ON A STEEP SOUTHEAST SLOPE IN TIMBER, 150'± EAST OF A RIDGE.</p> <p>FD. A 16" PONDEROSA PINE, N39°E, 12.6' -VS REC. A 14" PINE, N39°50'05"E, 12.56' (J)13 SCRIBED A 13" INCENSE CEDAR, N85°W, 16.8' "T23N R14E S32 BT"</p>
<p>CORNER No. 5</p> <p>LS 2843 FD. AN ALUM. CAP ON A 1/2" REBAR PER 9 R/S 50. CORNER FALLS ON A GENTLY SLOPING PINE TIMBERED FLAT, 20'± EAST OF A ROAD.</p> <p>NO ACCESSORIES - PRIVATE LAND</p>			<p>R13E T23N S36 S1 T22N LS 4753 2003</p> <p>CORNER No. 28</p> <p>FD. A PLASTIC CAP MARKED LS 3297 IN A 1" PIPE (1/2" PIPE PER 2 PM 1 AND 7 PM 29). REPLACED WITH A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE ON THE NORTH EDGE OF A DIRT ROAD.</p> <p>SCRIBED A 15" PONDEROSA PINE, S58°W, 37.8' "T22N R13E S1 BT" SCRIBED A 14" PONDEROSA PINE, N16°W, 27.8' "T23N R13E S36 BT"</p>	
<p>C. BROWN CORNER No. 6</p> <p>RCE 22836 FD. A PLASTIC CAP ON A 5/8" REBAR IN A 1" PIPE PER (J)2. CORNER FALLS 40'± SOUTHWEST OF A ROAD.</p> <p>FD. A 14" PONDEROSA PINE, S44°W, 20.8' (K-TAGGED) REC. A 12" PINE, S44°E, 20.8' (J)2</p>	<p>E 1/16 C—C S35 LS 4753 2003</p> <p>CORNER No. 14</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD IN A MOUND OF STONE. CORNER FALLS IN A CLEARING, 25'± EAST OF A SMALL DRAINAGE.</p> <p>SCRIBED A 14" PONDEROSA PINE, S59°W, 116.2' "CE 1/16 S35 BT" BARK SCRIBED A 21" PONDEROSA PINE, N21°W, 52.0' "CE 1/16 S35 BT"</p>	<p>T23N R13E S34 S35 T22N S3 S2 LS 4753 2003</p> <p>CORNER No. 19</p> <p>FD. A 3/4" PIPE TAGGED LS 2843 PER 5 R/S 33. REPLACED WITH A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD AND LAID PIPE ALONGSIDE. CORNER FALLS AT THE NORTHEAST CORNER OF SEWER PONDS AT SOUTH, WEST AND EAST FENCES.</p> <p>NO ACCESSORIES</p>		<p>LS 5623</p> <p>CORNER No. 37</p> <p>FD. A PLASTIC CAP ON A 1/2" REBAR PER (J)13. CORNER FALLS ON A MODERATE NORTHWEST SLOPE IN HEAVY BRUSH IN AN OLD BURN.</p> <p>NO ACCESSORIES</p>
<p>CORNER No. 7</p> <p>LS 2843 FD. AN ALUM. CAP ON A 5/8" REBAR PER (J)3. CORNER FALLS IN AN OPEN SAGE FLAT AT EAST NORTH FENCE CORNER.</p> <p>NO ACCESSORIES</p>	<p>T23N R13E 1/4 S35 S36 LS 4753 2003</p> <p>CORNER No. 15</p> <p>FD. A 3/4" PIPE TAGGED LS 2843 PER (J)2. REPLACED WITH A 3 1/4" ALUM. USFS CAP ON A 5/8" ALUM. ROD. CORNER FALLS ON THE NORTHEAST CORNER OF A CLEARED LOT.</p> <p>SCRIBED A 13" PONDEROSA PINE, 19.7' "1/4 S35 BT"</p>	<p>T23N R13E S35 S2 T22N LS 4753 2003</p> <p>CORNER No. 20</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. PIPE PER (J)4 NOT FD. CORNER FALLS NORTH OF PORTOLA SEWER PONDS INSIDE HIGH WATER MARK OF RIVER.</p> <p>SET A 2" ALUM. CAP STAMPED "RM T22N R13E S2" ON A 5/8" REBAR, S79°W, 25.0' FOR R.M. SET A 2" ALUM. CAP STAMPED "RM T22N R13E S35" ON A 5/8" REBAR, N59°W, 30.6' FOR R.M.</p>	<p>T22N R13E S1 1971</p> <p>CORNER No. 30</p> <p>FD. A BLM BCIP IN A MOUND OF STONE. CORNER FALLS IN BRUSH IN AN OLD BURN.</p> <p>NO ACCESSORIES</p>	<p>LS 5623</p> <p>CORNER No. 38</p> <p>FD. A PLASTIC CAP ON A 1/2" REBAR PER (J)13. CORNER FALLS ON A MODERATE NORTHEAST SLOPE IN CEDAR, FIR AND PINE.</p> <p>NO ACCESSORIES</p>
<p>CORNER No. 8</p> <p>LS 2843 FD. AN ALUM. CAP ON A 5/8" REBAR PER (J)3. CORNER FALLS IN A SAGE AND PONDEROSA PINE FLAT AT AN EAST, WEST, NORTH FENCE CORNER.</p> <p>NO ACCESSORIES</p>	<p>S 1/16 S34 S35 LS 4753 2003</p> <p>CORNER No. 16</p> <p>FD. AN UNMARKED 3/4" PIPE. REPLACED WITH A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE AT THE EDGE OF LANDSCAPING.</p> <p>SCRIBED A 10" PONDEROSA PINE, N82°E, 143.4' "S 1/16 S35 BT" SCRIBED AN 8" PONDEROSA PINE, N49°E, 105.1' "S 1/16 S35 BT"</p>	<p>T23N R13E 35 36 21 LS 2843</p> <p>CORNER No. 21</p> <p>FD. 1 1/2" ALUM. CAP ON A 1/2" REBAR PER 10 R/S 99. CORNER FALLS ON THE EDGE OF FEATHER RIVER, 75'± SOUTH OF HWY 70.</p> <p>FD. 1 1/2" ALUM. CAP ON A 1/2" REBAR MARKED FOR WITNESS CORNER, N 1°34'44"W, 38.86' REC. N 1°38'46"E, 38.86' (10 RS 99)</p>	<p>T22N R13E S1 R13E LS 4753 2003</p> <p>CORNER No. 31</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD. CORNER FALLS ON A MODERATE WEST SLOPE IN BRUSH IN AN OLD BURN.</p> <p>NO ACCESSORIES</p>	<p>T22N R13E S1 S12 1975</p> <p>CORNER No. 39</p> <p>FD. A BLM BCIP IN A MOUND OF STONE. CORNER FALLS ON A STEEP NORTHEAST SLOPE IN HEAVY BRUSH IN AN OLD BURN.</p> <p>NO ACCESSORIES - IN BURN</p>
<p>N 1/16 S35 S36 LS 4753 2003</p> <p>CORNER No. 9</p> <p>FD. A PLASTIC CAP MARKED RCE 22863 ON A 1/2" REBAR PER (J)2. REPLACED WITH A 3 1/4" ALUM USFS CAP ON A 5/8" ALUM. ROD. CORNER FALLS 50'± WEST OF DAVIS LAKE ROAD.</p> <p>SCRIBED AN 8" PONDEROSA PINE, N4°E, 8.6' "N 1/16 S36 BT" SCRIBED AN 8" PONDEROSA PINE, S78°W, 5.6' "N 1/16 S35 BT"</p>	<p>SE 1/16 S35 LS 4753 2003</p> <p>CORNER No. 17</p> <p>SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD IN A MOUND OF STONE. CORNER FALLS 5' NORTHWEST FROM POWER POLE AT ANGLE POINT IN POWER LINE.</p> <p>SCRIBED AN 11" PONDEROSA PINE, N77°W, 106.8' "SE 1/16 S35 BT" SCRIBED A 16" PONDEROSA PINE, N6°W, 115.5' "SE 1/16 S35 BT"</p>	<p>T23N R13E R14E S36 S30 S31 1953</p> <p>CORNER No. 23</p> <p>FD. A USDA FOREST SERVICE BRASS CAPPED IRON PIPE IN A MOUND OF STONE. CORNER FALLS ON A GENTLE NORTHWEST SLOPE, 60'± SOUTHWEST IDLE HOUR RP INT-X DRIVEWAY SOUTH.</p> <p>FD. A 23" PONDEROSA PINE, N20°E, 22.9' -HB REC. A 12" YELLOW PINE, N19°34'E, 34 LKS (BLM 1953) FD. A 34" PONDEROSA PINE, S79°E, 100.0' -HB REC. A 20" YELLOW PINE, S78°19'E, 150 LKS (BLM 1953)</p>	<p>T22N R14E 1/4 S31 S6 LS 5623 199</p> <p>CORNER No. 32</p> <p>FD. A 3 1/4" USFS ALUM. CAP IN A LARGE MOUND OF STONE. CORNER FALLS ON TOP OF A ROCKY RIDGE.</p> <p>NO ACCESSORIES</p>	<p>LS 5623</p> <p>CORNER No. 33</p> <p>FD. A PLASTIC CAP ON A 5/8" REBAR PER (J)13 IN A LARGE MOUND OF STONE. CORNER FALLS ON A STEEP SOUTHWEST SLOPE IN SCATTERED TIMBER AND BRUSH.</p> <p>NO ACCESSORIES</p>
<p>T23N R13E 1/4 S33 S34 LS 5632 2001</p> <p>CORNER No. 10</p> <p>FD. A 3 1/4" ALUM USFS CAP ON A 5/8" ALUM. ROD PER 12 R/S 90 IN A MOUND OF STONE. CORNER FALLS IN A FLAT WITH SCATTERED PINE.</p> <p>FD. AN 18" PONDEROSA PINE, S66°W, 35.4' -VS REC. A 20" PINE, S66°10'W, 35.4' (12 R/S 90) FD. A 16" PONDEROSA PINE, N22°W, 27.7' -VS REC. AN 18" PINE, N21°53'W, 27.7' (12 R/S 90) FD. A 12" PONDEROSA PINE, N51°E, 39.4' -VS REC. A 12" PINE, N51°05'E, 39.4' (12 R/S 90) FD. A 12" PONDEROSA PINE, S67°E, 60.6' -VS REC. A 12" PINE, S66°53'E, 60.6' (12 R/S 90)</p>	<p>CORNER No. 18</p> <p>FD. AN UNTAGGED 2" PIPE AT FENCE CORNER. TAGGED LS 2843 PER (J)3. NO TAG SET.</p> <p>FD. A 36" PINE STUMP, S84°W, 13.6' (CUT OFF AT GROUND LEVEL) REC. A 36" PINE, S84°28'W, 13.6' (J)3</p>	<p>RM T23N R13E S29 9.8' TO COR LS 4753 2003</p> <p>CORNER No. 25</p> <p>FD. A 30" PONDEROSA PINE TREE CORNER WITH BLAZES ON 4 SIDES. CORNER FALLS 75'± NORTH OF A FLAT, BARE SPUR ON A NORTHWEST SLOPE. SET A 3 1/4" ALUM. CAP ON A 3/4" ALUM ROD FOR REFERENCE MONUMENT N 13°E, 9.8' FROM TREE CORNER.</p> <p>SCRIBED A 6" PONDEROSA PINE, S1°W, 30.2' "X BT" SCRIBED AN 11" PONDEROSA PINE, S87 1/2°E, 34.7' "T23N R14E S32 BT"</p>	<p>LS 5623</p> <p>CORNER No. 34</p> <p>FD. A PLASTIC CAP ON A 5/8" REBAR PER (J)13 - NO MOUND. CORNER FALLS ON A MODERATE SOUTHWEST SLOPE IN SMALL CEDARS, 50'± NORTH OF A ROAD.</p> <p>NO ACCESSORIES</p>	


RECORD OF SURVEY

FOR

USDA FOREST SERVICE
PLUMAS NATIONAL FOREST

"MAYBIE"

IN SECTIONS 34, 35 AND 36, T. 23 N, R. 13 E.,
SECTION 31, T. 23 N, R. 14 E.,
SECTION 25, T. 22 N, R. 12 E.,
SECTIONS 16, 17, 18, 28, 29, 30 AND 33,
T. 22 N, R. 13 E.,
SECTIONS 5, 6, 7, 8 AND 9, T. 22 N, R. 14 E.,
AND SECTIONS 3 AND 4, T. 21 N, R. 13 E., M.D.M.,
IN THE UNINCORPORATED AREA OF PLUMAS COUNTY,
STATE OF CALIFORNIA

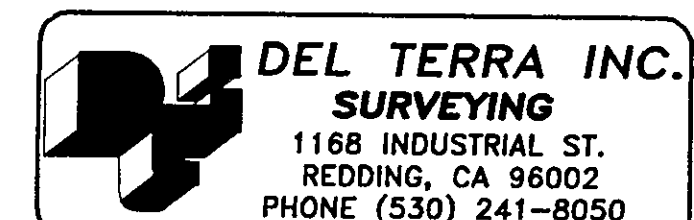

SCALE: NONE DATE: AUGUST, 2003
SHEET 7 OF 11