

<p>T30N R7E CORNER No. 30 $\frac{1}{4}$ SET STD USFS MONUMENT IN A MOUND OF STONE S28 S27 AT PROPORTIONED POSITION IN THE STUMP LS 4753 HOLE OF A LARGE OLD FIR. NO SCRIBING FD. 2003 CORNER FALLS ON A MODERATE NORTHEAST SLOPE IN TIMBER, 25° WEST OF ROAD 30N72 SCRIBED A 13" TAMARACK, S21E, 45.8' "1/4 S27 BT" SCRIBED A 16" WHITE FIR, S80W, 48.7' "1/4 S28 BT"</p>		<p>T30N R7E CORNER No. 35 S30 S29 FD. A 12 X 7 X 7 INCH (17 X 10 X 4) S31 S32 STONE WITH 5 NOTCHES EAST AND 1 NOTCH LS 4753 2003 SOUTH IN A SMALL MOUND OF STONE. SET STD USFS MONUMENT, REBUILT MOUND AND LAID MARKED STONE ALONGSIDE. CORNER FALLS IN A TIMBERED FLAT, 150± SOUTH OF AN OLD LOG LANDING. NO ORIGINAL BT'S FOUND SCRIBED AN 8" TAMARACK, N42E, 63.8' "T30N R7E S29 BT" SCRIBED A 9" TAMARACK, S31E, 38.6' "T30N R7E S32 BT" SCRIBED AN 11" TAMARACK, S55W, 43.2' "T30N R7E S31 BT" NO SUITABLE TREES IN SEC 30</p>		<p>CORNER NOTES CW = CARIBOU WILDERNESS HB = HEALED BLAZE VS = VISIBLE SCRIBING BCIP = BRASS CAPPED IRON PIPE STD. USFS MON. = 3 1/2" ALUM CAP ON A 2 1/2" ALUM PIPE. ()1 = REC. PER GLO</p>			
<p>T30N R7E CORNER No. 31 $\frac{1}{4}$ FD. A MOUND OF STONE. SET STD USFS S27 S26 MONUMENT AND REBUILT MOUND. CORNER FALLS LS 4753 ON A TIMBERED FLAT AT THE SOUTHWEST 2003 CORNER OF A SMALL, SEASONAL LAKE. SCRIBED A 17" TAMARACK, S14W, 25.8' "1/4 S27 BT" SCRIBED A 12" WHITE FIR, S79E, 33.3' "1/4 S26 BT"</p>		<p>T30N R7E CORNER No. 36 $\frac{1}{4}$ S29 FD. A 19 X 12 X 8 INCH (18 X 14 X 10) S32 2003 STONE MARKED "1/4" IN A MOUND OF STONE. LS 4753 SET STD USFS MONUMENT AND REBUILT MOUND 2003 WITH MARKED STONE AT BASE. CORNER FALLS ON A MODERATE WEST SLOPE, 25± WEST OF ROAD 30N72. SCRIBED A 16" WHITE FIR, S11E, 41.0' "1/4 S32 BT" SCRIBED A 12" WHITE FIR, N58W, 67.0' "1/4 S29 BT"</p>		<p>T30N R7E CORNER No. 40 $\frac{1}{4}$ S27 FD. A 14 X 9 X 8 INCH (16 X 8 X 7) S34 2003 STONE MARKED "1/4" IN A MOUND OF STONE. LS 4753 SET STD USFS MONUMENT, REBUILT MOUND AND LAID 2003 MARKED STONE ALONGSIDE. CORNER FALLS ON A FLAT, TIMBERED RIDGE. FD. A 20" TAMARACK, S35W, 30.4' -VS REC. A 10" LARCH, S37W, 48 LKS ()1 SCRIBED A 14" TAMARACK, N40W, 18.4' "1/4 S27 BT"</p>			
<p>T30N R6E R7E CORNER No. 32 S25 S30 FD. A 24 X 16 X 10 INCH (18 X 16 X 12) S36 S31 NOTCHED STONE DISPLACED 4' NW OF A MOUND LS 4753 OF STONE. SET STD USFS MONUMENT AND 2003 REBUILT MOUND WITH MARKED STONE AT BASE. CORNER FALLS ON TOP OF A SMALL RIDGE AT THE NORTHEAST CORNER OF A 5 X 5 X 3 FOOT BOULDER. FD. AN 18" TAMARACK, N38E, 46.2' -HB REC. A 6" LARCH, N38E, 70 LKS ()1 FD. A ROTTED RED FIR STUMP, S35E, 23.8' REC. A 38" RED FIR, S35E, 39 LKS ()1 FD. A DEAD AND DOWN TAMARACK, S32W, 87.8' -VS REC. A 12" LARCH, S32W, 133 LKS ()1 FD. A 17" TAMARACK, N70E, 39.8' -HB REC. A 4" LARCH, N70E, 60 LKS ()1 SCRIBED AN 18" TAMARACK, S61E, 16.8' "T30N R7E S31 BT" SCRIBED A 7" TAMARACK, S63W, 18.0' "X BT"</p>		<p>T30N R7E CORNER No. 37 S29 S28 FD. A 23 X 14 X 9 INCH (17 X 10 X 9) S32 S33 STONE WITH 1 NOTCH SOUTH AND 4 NOTCHES LS 4753 2003 WEST IN A MOUND OF STONE. SET STD USFS MONUMENT AND REBUILT MOUND WITH MARKED STONE AT BASE. CORNER FALLS ON A GENTLE SOUTHEAST SLOPING FLAT SPUR IN SCATTERED TIMBER. FD. A 12" TAMARACK SNAG, N4E, 27.0' -VS REC. A 6" LARCH, N4E, 41 LKS ()1 SCRIBED A 15" TAMARACK, N50E, 41.2' "T30N R7E S28 BT" SCRIBED A 10" TAMARACK, S19E, 67.7' "T30N R7E S33 BT" SCRIBED A 12" TAMARACK, S25W, 41.3' "T30N R7E S32 BT" NO SUITABLE TREES IN SEC 29</p>		<p>T30N R7E CORNER No. 41 S27 S26 FD. A 16 X 13 X 8 INCH STONE WITH 1 NOTCH S34 S35 SOUTH AND 1 NOTCH EAST PER ()1 IN A MOUND OF LS 4753 2003 STONE. SET STD USFS MONUMENT AND REBUILT MOUND WITH MARKED STONE AT BASE. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE. FD. ROTTEN STUMP, N56W, 15.3' REC. A 17" LARCH, N50W, 23 LKS ()1 FD. A TAMARACK SNAG, S54W, 52.8' -VS REC. A 16" LARCH, S56W, 80 LKS ()1 FD. A TAMARACK STUMP, S63E, 69.0' REC. A 14" LARCH, S60E, 112 LKS ()1 SCRIBED AN 8" WHITE FIR, N20E, 33.8' "T30N R7E S26 BT" SCRIBED A 10" DOUGLAS FIR, N5W, 37.9' "T30N R7E S27 BT" SCRIBED AN 8" WHITE FIR, S74W, 36.3' "T30N R7E S34 BT"</p>			
<p>T30N R7E CORNER No. 33 $\frac{1}{4}$ S30 FD. A 13 X 9 X 7 INCH (16 X 9 X 8) S31 MARKED STONE MARKED "1/4" IN A MOUND OF LS 4753 STONE. SET STD USFS MONUMENT, REBUILT 2003 MOUND AND LAID MARKED STONE ALONGSIDE. CORNER FALLS ON A STEEP WEST SLOPE, 200± EAST OF A FLAT CREEK BED. SCRIBED AN 18" DOUGLAS FIR, N8W, 46.7' "1/4 S30 BT" SCRIBED A 10" WHITE FIR, S60W, 39.3' "1/4 S31 BT"</p>		<p>T30N R7E CORNER No. 38 $\frac{1}{4}$ S28 FD. A 16 X 9 X 9 INCH (16 X 10 X 9) S33 LS 4753 STONE MARKED "1/4" IN A MOUND OF STONE. 2003 SET STD USFS MONUMENT AND REBUILT MOUND WITH MARKED STONE AT BASE. CORNER FALLS IN THICK TIMBER 175± WEST OF A MEADOW. FD. A TAMARACK SNAG, N28W, 29.0' -VS REC. A 24" LARCH, N28W, 44 LKS ()1 SCRIBED A 16" TAMARACK, N22E, 4.7' "1/4 S28 BT" SCRIBED AN 11" TAMARACK, S12E, 69.6' "1/4 S33 BT"</p>		<p>T30N R7E CORNER No. 42 S31 S32 FD. A 13 X 10 X 9 INCH (16 X 8 X 7) LS 4753 STONE MARKED "1/4" ON WEST FACE. SET STD 2003 USFS MONUMENT AND REBUILT MOUND WITH MARKED STONE AT BASE. CORNER FALLS ON A TIMBERED FLAT. FD. TAMARACK REMAINS, N76E, 13.9' REC. A 9" LARCH, N76E, 21 LKS ()1 FD. A ROTTED TAMARACK STUMP, N28W, 12.5' -VS REC. A 24" LARCH, N78W, 19 LKS ()1 SCRIBED A 9" RED FIR, N73E, 37.1' "1/4 S32 BT" SCRIBED A 10" RED FIR, S52W, 23.7' "1/4 S31 BT"</p>			
<p>E$\frac{1}{16}$ S30 CORNER No. 34 S31 SET STD USFS MONUMENT. NO MOUND. CORNER LS 4753 FALLS ON A SMALL, FLAT SHELF IN THICK 2003 TAMARACK. SCRIBED A 14" TAMARACK, S18 1/4W, 15.6' "E 1/16 S31 BT" SCRIBED A 15" WHITE FIR, N69E, 18.4' "E 1/16 S30 BT"</p>		<p>T30N R7E CORNER No. 39 S28 S27 FD. A LARGE EMBEDDED MOUND OF STONE. SET S33 S34 STD USFS MONUMENT AND REBUILT MOUND. LS 4753 CORNER FALLS ON A STEEP NORTHEAST SLOPE. 2003 150± SOUTHWEST OF A DRAINAGE IN A FLAT. FD. A 31" RED FIR SNAG, N66W, 4.0' -HB REC. A 6" WHITE FIR, N66W, 6 LKS ()1 FD. A 30" RED FIR SNAG, N71E, 8.7' -HB REC. A 7" WHITE FIR, N71E, 13 LKS ()1 SCRIBED A 10" WHITE FIR, N3E, 8.7' "T30N R7E S27 BT" SCRIBED A 5" WHITE FIR, N38W, 11.9' "X BT" SCRIBED AN 8" WHITE FIR, S54W, 15.0' "T30N R7E S33 BT"</p>					

RECORD OF SURVEY


FOR

USDA FOREST SERVICE
 PLUMAS NATIONAL FOREST

"SOUTH CARIBOU"

IN SECTIONS 13, 14 & 23 IN THE UNINCORPORATED
 AREA OF LASSEN COUNTY, AND IN SECTIONS 23, 27,
 28, 29 AND 30 IN THE UNINCORPORATED AREA OF
 PLUMAS COUNTY,

ALL IN T 30 N, R 7 E, MDM,
 STATE OF CALIFORNIA

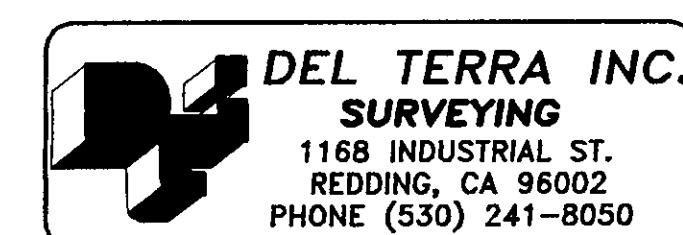

DATE: NOVEMBER, 2003
 SHEET 4 OF 4