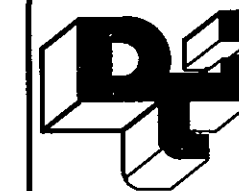


<p>LS 3346 T26N R9E S15 S14 S24 S23 1994</p> <p>CORNER No. 71</p> <p>FD. A USFS DRIVE IN MONUMENT IN A MOUND OF STONE PER 10 R/S 84. CORNER FALLS IN A FLAT, OPEN AREA, 50± EAST OF A LAKE.</p> <p>FD. AN 11" PINE, N23°E, 72.1' -VS REC. A 14" PINE, N23°21'E, 72.05' (10 R/S 84) FD. A 10" PINE, N52°E, 85.5' -VS REC. A 12" PINE, N52°32'E, 85.53' (10 R/S 84)</p>	<p>N 1/16 S21 S22 LS 4753 2008</p> <p>CORNER No. 77</p> <p>SET A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A TIMBERED FLAT.</p> <p>SCRIBED A 5" WHITE FIR, N54°E, 24.5' "X BT" SCRIBED A 20" PONDEROSA PINE, N80°W, 28.9' "N1/16 S21 BT"</p>	<p>CORNER NOTES CAF=COLLINS ALMANOR FORESTS HB = HEALED BLAZE VS = VISIBLE SCRIBING BCIP = BRASS CAPPED IRON PIPE USFS DRIVE IN MON. = 3-1/4" ALUM CAP ON A 5/8" ALUM. ROD</p>	<p>T27N R9E 1/4 S19 S20 LS 4753 2007</p> <p>CORNER No. 90</p> <p>NO ORIGINAL EVIDENCE FOUND SET BY SINGLE PROPORTION A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A GENTLE WEST SLOPE IN TIMBER.</p> <p>SCRIBED A 10" DOUGLAS FIR, S88°W, 26.3' "1/4 S19 BT" SCRIBED A 14" DOUGLAS FIR, N20°E, 11.7' "1/4 S20 BT"</p>	<p>T26N R10E 1/4 S15 S22 LS 4753 2008</p> <p>CORNER No. 96</p> <p>FD. A 18X12X6 INCH STONE MKD "1/4" IN A MOUND OF STONE. SET A USFS DRIVE IN MONUMENT AND REBUILT MOUND. CORNER FALLS ON A STEEP EAST SLOPE.</p> <p>RECORD 18X12X6 STONE PER GLO D.D. BROWN 1869 SCRIBED A 11" PONDEROSA PINE, S18°E, 14.5' "1/4 S22 BT" SCRIBED A 15" DOUGLAS FIR, N66°W, 13.4' "1/4 S15 BT"</p>
<p>WC →20FT W 1/16 S14 S23 LS 5623 2004</p> <p>CORNER No. 72</p> <p>FD. A USFS DRIVE IN MONUMENT FOR WITNESS CORNER AND A 1" CAP ON A 3/4" REBAR MARKED LS5623. CORNER FALLS IN ROAD NO RECORD</p> <p>FD. A 13" WHITE FIR S44°W, 31.4' -VS NO REC.</p>	<p>C N 1/16 S22 C LS 4753 2008</p> <p>CORNER No. 78</p> <p>SET A USFS DRIVE IN MONUMENT, NO MOUND. CORNER FALLS ON A GRASSY FLAT, 300± SOUTHWEST OF ROUND VALLEY RESERVOIR.</p> <p>NO ACCESSORIES AVAILABLE</p>	<p>T27N R9E 1/4 S18 S17 LS 4753 2007</p> <p>CORNER No. 84</p> <p>FD. A 3/4" IRON PIPE NO REC. SET A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS 15' WEST OF HAUNS CREEK.</p> <p>FD. A TAGGED 15" DOUGLAS FIR, S3°E, 9.9' NO REC. FD. A TAGGED 18" INCENSE CEDAR, S83°E, 37.6' NO REC. SCRIBED AN 8" WHITE FIR, S5°W, 16.1' "1/4 S18 BT"</p>	<p>T27N R9E C 1/4 · S20 LS 4753 2007</p> <p>CORNER No. 91</p> <p>SET A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A GENTLE SOUTHEAST SLOPE, 40± EAST OF A ROAD.</p> <p>SCRIBED AN 11" INCENSE CEDAR, N13°W, 25.0' "C1/4 S20 BT" SCRIBED A 13" PONDEROSA PINE, N76°E, 31.6' "C1/4 S20 BT"</p>	<p>T26N R10E S15 S14 S22 S23 1970</p> <p>CORNER No. 99</p> <p>FD. A BLM BCIP IN A MOUND OF STONE. CORNER FALLS AT THE WEST EDGE OF A SOUTH FACING SPUR.</p> <p>FD. A 10" OAK, S 82°W, 3.0' NO RECORD. FD. AN 8" OAK, S 2°E, 9.2' REC. 6" OAK, S 2°E, 14 LKS PER BLM A SYDLIK FD. A 7" OAK, N 40°E, 37.6' REC. 6" OAK, N 40°E, 57 LKS PER BLM A SYDLIK</p>
<p>T26N R9E S14 1/4 S23 LS 3346 1994</p> <p>CORNER No. 73</p> <p>NOTHING FOUND OR SET. FD. A USFS DRIVE IN MONUMENT IN A MOUND OF STONE PER 10 R/S 84. MONUMENT BEARS S79°10'E 42.55' FROM TRUE POSITION DETERMINED BY SINGLE PROPORTION, CORNER APPARENTLY MISSET.</p> <p>FD. AN 11" BLACK OAK, N7°W, 56.3' -VS REC. A 14" OAK, N6°51'W, 56.33' (10 R/S 84) FD. A 22" INCENSE CEDAR, S11°W, 19.0' -VS REC. A 30" CEDAR, S10°50'W, 20.16' (10 R/S 84)</p>	<p>LS 4655</p> <p>CORNER No. 79</p> <p>FD. A 3/4" IRON PIPE ON A MOUND OF STONE NO REC. CORNER FALLS ON GENTLE E SLOPE IN TIMBER. NOT OF RECORD</p> <p>FD. A 14" WHITE FIR, S25°W, 12.4' -HB NO REC. FD. A 23" DOUGLAS FIR, N66°E, 55.7' -HB NO REC.</p>	<p>T27N R9E C 1/4 · S17 LS 4753 2007</p> <p>CORNER No. 85</p> <p>SET A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A STEEP SOUTHWEST SLOPE IN LIGHT TIMBER, 250± EAST OF A ROAD.</p> <p>SCRIBED A 20" PONDEROSA PINE, S53°W, 24.7' "C1/4 S17 BT" SCRIBED A 17" DOUGLAS FIR, N14°W, 25.1' "C1/4 S17 BT"</p>	<p>T27N R9E 1/4 S20 S21 CAF 1967</p> <p>CORNER No. 92</p> <p>FD. A CAF CAP IN A MOUND OF STONE. CORNER FALLS IN ROCKY FLAT BETWEEN CREEK FORKS.</p> <p>FD. A TAGGED 24" FIR SNAG, N49°W, 27.7' NO REC. FD. AN 18" INCENSE CEDAR, S50°W, 33.0' -VS REC. 12" CEDAR S50°W, 40 LKS-GLO 1882 FD. A TAGGED 27" DOUGLAS FIR, N72°E, 49.5' NO REC.</p>	<p>T27N R9E S17 S16 S20 S21 CAF 1971</p> <p>CORNER No. 100</p> <p>FD. A 2-1/2" CAF CAP IN A MOUND OF STONE. CORNER FALLS ON AN EAST SLOPE IN THICK TIMBER.</p> <p>FD. A 16" BLACK OAK, S70°W, 12.6' REC. 6" OAK S68°W, 19 LKS-(GLO 1882) FD. A 23" DOUGLAS FIR, S56°E, 71.5' -HB REC. 6" FIR S56°E, 70 LKS-(GLO 1882) FD. A 37" SUGAR PINE, N31°W, 31.7' REC. 12" PINE N38°W 47 LKS-(GLO1882) FD. A TAGGED 29" PONDEROSA PINE, N87°W, 44.9' NO REC.</p>
<p>E 1/16 S14 S23 LS 4753 2008</p> <p>CORNER No. 74</p> <p>SET A USFS DRIVE IN MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A STEEP NORTH SLOPE IN TIMBER.</p> <p>SCRIBED AN 8" WHITE FIR, N72°E, 10.8' "E1/16 S14 BT" SCRIBED A 15" WHITE FIR, S28°W, 20.5' E1/16 S23 BT"</p>	<p>T26N R9E 1/4 S22 S23 LS 5287 1983</p> <p>CORNER No. 80</p> <p>FD. A 3 1/4" USFS ALUM. CAP ON A 2" ALUM PIPE IN A MOUND OF STONE PER 7 R/S 14. CORNER FALLS ON A STEEP NORTH SLOPE.</p> <p>FD. A 31" DOUGLAS FIR, N44 1/2°E, 21.1' -HB REC. A 30" FIR, N43°22'E, 21.4' (7 R/S 14) FD. A 20" DOUGLAS FIR, S68°W, 23.0' -HB REC. AN 15" W FIR, S68°W, 23.0' (7 R/S 14) FD. AN 11" CEDAR, S54°E, 29.8' -VS REC. A 7" CEDAR, S54°E, 29.8' (7 R/S 14)</p>	<p>T27N R9E 1/4 S17 S16 CAF 1967</p> <p>CORNER No. 86</p> <p>FD. A CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A MODERATE SOUTH SLOPE.</p> <p>FD. A TAGGED 40" DOUGLAS FIR, S84°W, 32.1' NO REC. FD. A 26" DOUGLAS FIR, N40°E, 23.1' - CHOPPED OPEN REC. A 14" FIR, N40°E, 35 LKS (GLO 1882) FD. A 29" PONDEROSA PINE, S66°W, 72.6' NO REC.</p>	<p>T27N R9E S19 S20 S30 S29 CAF 1973</p> <p>CORNER No. 93</p> <p>FD. A CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A MODERATE SOUTH SLOPE, 30' NORTH OF ROAD.</p> <p>FD. A 29" PONDEROSA PINE, N28°W, 62.7' REC. A 12" SUGAR PINE, N33°W, (GLO 1882) FD. A CUT PINE STUMP, N55°E, 48.2' REC. 40" SUGAR PINE, N54°E, 70 LKS (GLO 1882) FD. A TAGGED 16" PONDEROSA PINE, S6°W, 42.9' NO REC.</p>	<p>1/4 S16 S21 CAF 1965</p> <p>CORNER No. 104</p> <p>FD. A 2-1/2" CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A FLAT IN SCATTERED TIMBER.</p> <p>FD. A TAGGED 16" CEDAR N78°W, 16.6' -NO MKS NO REC.</p>
<p>T26N R9E S14 S13 S23 S24 LS 3346 1995</p> <p>CORNER No. 75</p> <p>FD. A USFS DRIVE IN MONUMENT IN A MOUND OF STONE PER 10 R/S 84. CORNER FALLS ON A STEEP SOUTHEAST SLOPE IN SMALL TIMBER, 70± SOUTHWEST OF A ROAD.</p> <p>FD. AN 8" INCENSE CEDAR, N64°E, 6.0' -VS REC. AN 8" CEDAR, N76°40'E, 5.79' (10 R/S 84) FD. A 16" BLACK OAK, S76°E, 17.3' -VS REC. A 24" OAK, S77°46'E, 17.20' (10 R/S 84) FD. A 12" WHITE FIR, S80°W, 31.0' -VS REC. A 12" FIR, S81°15'W, 30.82' (10 R/S 84) FD. A 17" INCENSE CEDAR, N42°W, 17.0' -VS REC. A 16" CEDAR, N41°12'W, 17.26' (10 R/S 84)</p>	<p>T26N R9E 1/4 S22 S27 LS 5287 1986</p> <p>CORNER No. 81</p> <p>FD. A 3 1/4" USFS ALUM. CAP ON A 2" ALUM PIPE IN A MOUND OF STONE PER 7 R/S 14. CORNER FALLS ON A STEEP WEST SLOPE IN TIMBER.</p> <p>FD. A 26" WHITE FIR, S19°W, 28.7' -HB REC. A 16" WHITE FIR, S19°W, 28.6' (7 R/S 14) FD. A 12" DOUGLAS FIR, N2°E, 25.0' -HB REC. A 5" DOUGLAS FIR, N2°E, 24.9' (7 R/S 14)</p>	<p>T27N R9E S18 S17 S19 S20 CAF 1971</p> <p>CORNER No. 88</p> <p>FD. A 2-1/2" CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A FLAT IN DENSE TIMBER.</p> <p>FD. A 14" INCENSE CEDAR, S71°W, 11.9' NO REC. FD. A 23" WHITE FIR, S18°E, 38.9' NO REC. FD. A 19" WHITE FIR, N76°E, 19.8' NO REC. FD. A 33" INCENSE CEDAR, N56°E, 38.9' REC. A 12" CEDAR, N55°E, 57 LKS (GLO 1882)</p>	<p>T27N R9E 1/4 S20 S29 CAF 1967</p> <p>CORNER No. 94</p> <p>FD. A 2-1/2" CAF CAP IN A MOUND OF STONE. CORNER FALLS ON MODERATE S SLOPE IN TIMBER.</p> <p>FD. A TAGGED 20" SUGAR PINE, WEST, 7.9' NO REC. FD. A 20" PONDEROSA PINE, N13°W, 20.5' REC. A 24" Y. PINE S10°W, 24 LKS-(GLO 1882) FD. A 29" PONDEROSA PINE, N68°E, 33.0' -VS REC. A 16" YELLOW PINE, N68°E, 50 LKS (GLO 1882) FD. A TAGGED 7" PONDEROSA PINE, S13°E, 10.6' NO REC.</p>	<p>FD. A TAGGED 16" CEDAR N78°W, 16.6' -NO MKS NO REC.</p>
<p>T26N R9E S16 S15 S21 S22 1973</p> <p>CORNER No. 76</p> <p>FD. A BLM BCIP IN A MOUND OF STONE. CORNER FALLS IN A DENSELY TIMBERED FLAT, 150± EAST OF A ROAD. PER 10 R/S 84</p> <p>FD. A 35" PONDEROSA PINE, N67°E, 38.9' -VS REC. A 35" YELLOW PINE, N66 1/2°E, 61 LKS (BLM) FD. A 20" WHITE FIR, S45°E, 65.3' -HB REC. A 14" WHITE FIR, S45°E, 99 LKS (BLM) FD. A 24" SUGAR PINE, S30°W, 25.7' -HB REC. A 16" SUGAR PINE, S30°W, 39 LKS (BLM) FD. A 19" WHITE FIR, N84°W, 11.9' -HB REC. A 12" WHITE FIR, N84°W, 18 LKS (BLM) FD. A 31" PONDEROSA PINE, N36 1/2°W, 43.6' -VS REC. A 28" PONDEROSA PINE, N36 1/2°W, 66 LKS (BLM)</p>	<p>FD. A 26" DOUGLAS FIR, S27°W, 10.3' -HB REC. A 23" DOUGLAS FIR, S27°W, 15 LKS (USFS COR SEARCH REC.) 11/16/71) FD. A 30" SUGAR PINE, S20°E, 19.8' REC. A 21" SUGAR PINE, S20°E, 32 LKS (USFS COR SEARCH REC)</p> <p>T27N R9E 1/4 S8 S17 CAF 1967</p> <p>CORNER No. 83</p> <p>FD. A CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A STEEP SOUTHWEST SLOPE IN TIMBER.</p> <p>FD. A 19" INCENSE CEDAR, S57 1/2°E, 29.7' REC. A 19" INCENSE CEDAR, S57 1/2°E, 45 LKS FD. A 19" SUGAR PINE, N54°E, 19.8' REC. A 13" SUGAR PINE, N54°E, 30 LKS FD. A 24" INCENSE CEDAR, N1°W, 42.2' REC. A 10" CEDAR, N2°W, 60 LKS (USFS COR SEARCH REC, 5/17/67)</p>	<p>T27N R9E 1/4 S17 S20 CAF 1971</p> <p>CORNER No. 89</p> <p>FD. A CAF CAP IN A MOUND OF STONE. CORNER FALLS ON A GENTLE EAST SLOPE IN TIMBER, 60± EAST OF A ROAD.</p> <p>FD. A 16" INCENSE CEDAR, S6°E, 32.3' NO REC. FD. A 12" SUGAR PINE, N50°W, 9.4' NO REC. FD. A 31" WHITE FIR, S62°W, 26' -HB REC. A 16" FIR, S63°W, 30 LKS (GLO 1882)</p>	<p>T26N R10E S16 S15 S21 S22 1973</p> <p>CORNER No. 95</p> <p>FD. A BLM BCIP IN A MOUND OF STONE. CORNER FALLS 2' EAST OF A FENCE AND 40± WEST OF A ROAD.</p> <p>FD. A 16" PONDEROSA PINE, N10°W, 75.2' -HB REC A 16" YELLOW PINE N 10° W 114 LKS PER BLM A SYDLIK FD. A 10" PONDEROSA PINE, N41°E, 35.0' -HB REC A 10" YELLOW PINE N 41°E 53 LKS BLM A SYDLIK FD. A 14" PONDEROSA PINE, S32°E, 15.9' REC A 10 INCH YELLOW PINE S 32°E 24 LKS BLM A SYDLIK</p>	<p>USDA FOREST SERVICE PLUMAS NATIONAL FOREST "KEDDIE"</p> <p>IN SECTIONS 3, 8, 9, 10, 11, 15, 16 AND 22, T 26 N, R 9 E, MDM, AND IN SECTIONS 17 AND 20, T 27 N, R 9 E, MDM, IN THE UNINCORPORATED AREA OF PLUMAS COUNTY, STATE OF CALIFORNIA</p> <div data-bbox="2337 1713 2807 1862" style="border: 1px solid black; padding: 5px;">  <p>DEL TERRA INC. SURVEYING 1168 INDUSTRIAL ST. REDDING, CA 96002 PHONE (530) 241-8050</p> </div> <p>DATE: NOVEMBER, 2008 SHEET 8 OF 8</p>