


CORNER RECORD

COUNTY OF PLUMAS T. T26N R. 11E M. D. CALIFORNIA

CORNER TYPE: GOV'T. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION — DATE OF VISIT September 11, 1984

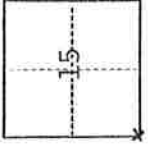


CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH RECORD:

Post in mound of stone
FOUND: No evidence of monument (skidded area), position re-established by resection from 3 original bearing trees (see "SKETCH").
 Basis of bearings by solar observation.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED

SET: A 2½" aluminum pipe, 30" long with a ¾" aluminum cap with Forest Service logo marked as at right, and with a magnet in a base designed to break off on impact.
 built a mound of stone 24"x24"x8".

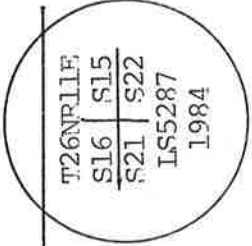

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD STATION _____ STATION _____
 STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER EASTINGS (X) _____
 ZONE _____ ELEVATION _____ NORTHINGS (Y) _____

(Fold)

SKETCH: (Include reference tie or witness points, remarks and topo of area)

FOUND: Original bearing trees:
 40½" White Fir N 29°35'E 47.3 links, closed blaze
 39" Ponderosa Pine S 30°06'E 48.8 links, closed blaze
 30" Cedar N 60°54'W 84.8 links, closed blaze
 Blazed and scribed new bearing trees:
 8" White Fir S 3°38'E 36.45 Ft, marked "T26N R11 E S22 BT"
 4" Douglas Fir N 12°W 14.33 Ft, marked "X" "BT"

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT
 ON 11-8

SIGNED: Robert Grauberg

L.S. or R.C.E. No.: LS 5287



COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED 11-28 1984
 AND EXAMINED AND FILED 11-28 1984

BY: Tom Shantz
 TITLE: Asst. Eng.

DOCUMENT No. 34

STATEMENT ON BACK OF SHEET

YES NO