

CORNER NOTES



1 NORTH 1/4 CORNER SECTION 25. Found a 3/4" iron pipe w/ 2 1/2" Alum. cap mkd. From which bears: A 28" D. Fir w/K tag dated 1936 (No blaze or scar) bears N44°E, 12'!



2 West 1/4 Corner Section 25. Found a 3/4" iron pipe w/ 2 1/2" Alum. cap mkd. as shown in Bk. 4, Records of Surveys, Pg. 129. From which bears: A 40" Dead Cedar w/K tag & visible scribe "4 S" bears S2°E, 7'!




3 EAST 1/4 CORNER SECTION 25. Found 3/4" iron pipe w/ 2 1/2" Alum. cap mkd. From which bears: A 25" D. Fir w/K tag (No blaze or scribe) bears S58°E, 74'!

4 SECTION CORNER 25, 26, 35 & 36. Found a 1" iron pipe w/ tag mkd. L.S. 3202 in mound of stone at intersection of fences. From which bears: A 12" Pine w/K tag (No blaze or scribe) bears N77°E, 15'!



5 SOUTH 1/4 CORNER SECTION 25. Found a 3/4" iron pipe w/ 2 1/2" Alum. cap mkd. From which bears: A 12" Pine w/K tag (No blaze or scribe) bears N86°E, 16'!

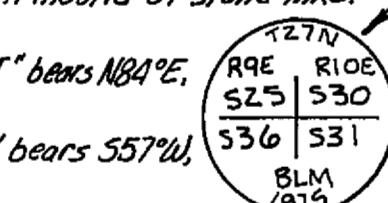


6 SECTION CORNER 25 & 36, R9E AND 30 & 31, R10E. Found a standard BLM. brass capped monument in mound of stone mkd. From which bears: A 13" Cedar w/K tag & scribing "T27N, R10E, S30, BT" bears N84°E, 22'!

7 WEST 1/4 CORNER SECTION 36. Found a 2" iron pipe with unmarked cap in mound of stone at intersection of fences, attached tag mkd. L.S. 4036. From which bears: A 15" Pine w/K tag & visible (unreadable) scribing bears N2°E, 28'!

8 EAST 1/4 CORNER SECTION 36. Set a 2" iron pipe mkd. L.S. 4036 in mound of stone. From which bears: A 10" B. Oak w/K tag (No blaze or scribe) bears N32°W, 27'!

9 SOUTH 1/4 CORNER SECTION 36. Found a standard BLM. brass capped monument in mound of stone mkd. From which bears: A 6" B. Oak scribed "1/4, S36, BT" bears N10°W, 36'!

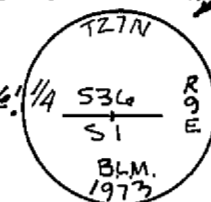

10 SOUTH EAST 1/16 CORNER SECTION 25. Set a 5/8" rebar with alum cap mkd. L.S. 4036. Mkd. the following bearing trees: An 8" Cedar "1/16, S25, BT" bears N10°W, 19'!

11 SOUTH 1/16 CORNER SECTION 25 & 30. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. Mkd. the following Bearing Trees: A 7" Pine scribed "1/16, S30, BT" bears N2°E, 18'!

12 WEST 1/16 CORNER SECTION 25 & 36. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. Mkd. the following Bearing Trees: A 16" Fir mkd "1/16, S25, BT" bears N16°W, 22'!

13 EAST 1/16 CORNER SECTION 25 & 36. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. Corner falls in road, no BT mkd. See E 1/16 W.C. Set witness corner N0°01'39"E, 25.00'

14 NORTH 1/16 CORNER SECTION 35 & 36. Position calculated by single proportion. Nothing set. A found 1" iron pipe w/ tag mkd. L.S. 3202 bears N78°34'00"E, 0.48'!

15 NORTH WEST 1/16 CORNER SECTION 36. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. Mkd. the following bearing trees: A 10" Fir scribed "1/16, S36, BT" bears N16°E, 36'!

16 CENTER NORTH 1/16 CORNER SECTION 36. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. No bearing trees within limits.

17 NORTH EAST 1/16 CORNER SECTION 36. Set a 5/8" rebar with alum. cap mkd. L.S. 4036. Mkd. the following bearing tree: A 20" Y. Pine scribed "1/16, S36, BT" bears N6°E, 7'!

RECORD OF SURVEY FOR GLEN PERSHING et al.

PORTIONS OF SECTIONS 25 & 36, T27N, R9E, MDM. IN THE UNINCORPORATED TERRITORY OF PLUMAS COUNTY, CALIFORNIA.

STEPHEN W. DEAN L.S. 4036 P.O. BOX 624 FALL RIVER MILLS, CALIF. 96028