

BASIS OF BEARINGS

is North/South Center Line of section 14 per 7 RS 26 and 7 RS 27 of Plumas Co. Records.


LEGEND

- Fd. Corner Monuments per 7 RS 27 and as noted.
- Corner Monuments set or reset during this Survey as noted
- Dimension Line
- () GLO Data
- [] Data per Book 7 RS pg. 27
- Key to Corner Descriptions
- } Lines Originally Marked and Posted for USFS on 7 RS 27. Any lines affected by this amendment were physically changed in the field.

CORNER DESCRIPTIONS

- ① 50" GLO W. Fir corner tree and B.T.S per 7 RS 27
40" Fir S54°E 46.2' (701ks GLO)
- ② 1/4 11 1974 BLM BCIP per 7 RS 27 and B.T.S:
38" W. Fir N17°E 19.2' (291ks GLO)
11" S. Pine S63°W 22.1' (33 1/2 lks BLM)
- ③ West 1/4 of sec. 11. set a std. USFS ACAP in a mos. mkd:
And Scribed B.T.:
12" Pine S42°E 81'
(CC 1/4 S11 BT)
- ④ Center 1/4 of Sec 11. I removed the C1/4 as shown on 7 RS 28 and moved it N2°21'27" E 27.8'. Corner is a std. USFS ACAP in a mos mkd:
From which bears a 20" Fir S55°W 67.3'
I destroyed the 19" Cedar as shown in Corner Desc.
* 72 on sheet 3 of 3 of 7 RS 29 and Scribed a new B.T.:
6" Cedar S71°W 13.2'
- ⑤ 1/4 11 12 1974 BLM BCIP and B.T.S:
Per 7 RS 28
18" Y. Pine West 28.4' (43 lks GLO)
25" Y. Pine S58°E 12.9' (21 lks GLO)
26" Y. Pine S82°W 34.2' (51 1/2 lks GLO)
- ⑥ 1/4 10 1974 BLM BCIP per 7 RS 28 is incorrectly stamped as 1/4 10 11. This is to be corrected by others.
- ⑦ S 1/4 of sec 11. I removed the S 1/4 as shown on 7 RS 28 and moved it N0°04'52" E 27.8'. The corner is a std. USFS ACAP in a mos mkd:
From which bears a 9" W. Fir N17°E - 14.2'
I destroyed the 12" Fir as shown on 7 RS 28
Corner Descriptions # 74.
- ⑧ SW 1/4 section 11. I removed the SW 1/4 as shown on 7 RS 28 and moved it N2°09'06" E 20.9'. The corner is a std. USFS ACAP in a mos mkd:
New B.T.:
8" W. Fir S40°W 15.3'
Fid. B.T. Per 7 RS 28
10" W. Fir S38°W 67.3'
I destroyed 12" W. Fir Per 7 RS 28 corner Descriptions # 75.
- ⑨ 1/4 11 14 Std. USFS ACAP mkd: LS4790 and B.T.S. Per 7 RS 28
18" Fir N69°E 16.3'
5" Pine S19°E 30.4'
- ⑩ W 1/4 11 15 Std. USFS ACAP mkd: LS4790 and B.T.S per 7 RS 28
9" Pine S32°E 71.2'

- ⑪ 1/4 11 1974 BLM BCIP and B.T.S per 7 RS 28
44" W. Fir S25°W 47.8' (72 lks GLO)
10" Cedar N66°E 32.3' (49 lks BLM)
- ⑫ 3/4" Iron Pipe tagged LS 2322 per 7 RS 28

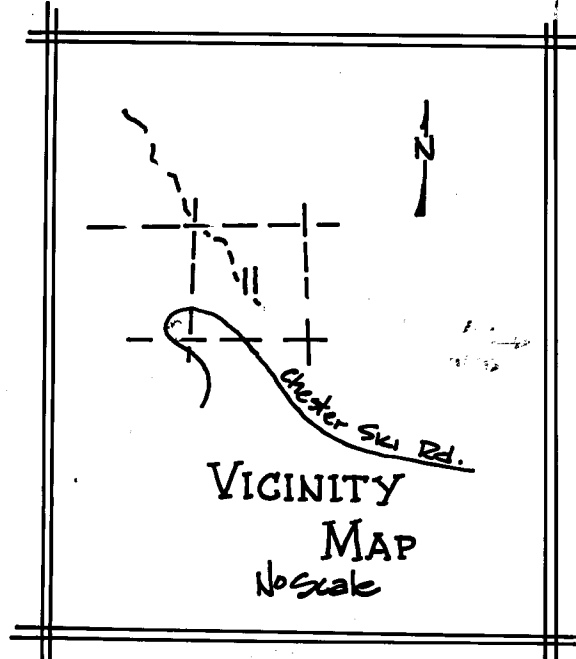

Project Team
Jay Burgess LS
E. Diggs Jr LSIT
Rick Van Tassel Tech.
Diane Carter Tech.
Aaron Halcy Tech.


GENERAL NOTES

- 1) Abbreviations:
GLO - Government Land Office
BLM - Bureau of Land Management
BCIP - Brass Cap and Iron Pipe
ACAP - Aluminum Cap and Pipe
USFS - United States Forest Service
amos - a mound of stone
BT - Bearing Tree
mkd - marked
- 2) This Map is amending 7 RS 27, due to using the BLM corner, mismarked 1/4 10 11. This map shows correct section breakdown using prorate position for 1/4 11 only.

SURVEYOR'S STATEMENT

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Land Surveyor's act at the request of the U.S.D.A. Forest Service in May of 1985.

Jay Burgess
Jay A. Burgess LS4790

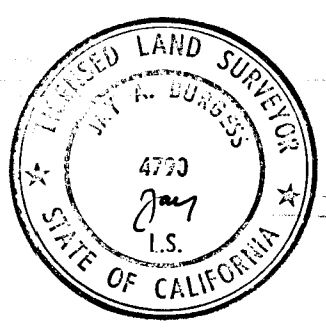

COUNTY SURVEYOR'S STATEMENT

This map has been examined in accordance with section 8706 of the Land Surveyor's act this 11th day of July 1985

County Surveyor Lawrence J. Brock RLE 13528

RECORDER'S CERTIFICATE

Filed this 11th day of July 1985 at 1:12 P.M. in Book 7 of Record of Surveys at page 41 at the request of the County Engineer.

County Recorder ILLA DIGGS
Deputy Beth Commark
File # 172 Fee \$ 5.00

AMENDING RECORD OF SURVEY FOR U.S.D.A. FOREST SERVICE - LASSEN "SKI CADASTRAL SURVEY"

Amending a portion of Section 11, T.28N, R.6E. M.P.M. per 7 RS 27 in the unincorporated territory of Plumas County, State of California.

BURGESS
Land Surveys
Redding, Calif.

1" = 1000'
E.L.R. 12.
May 1985
SHEET 1 of 1