

T22N R12E CORNER NO. 49
 $\frac{1}{4}$
S28|S27
LS 3966
1993

FD. A SMALL STONE IN A MOUND OF STONE AND K-TAG DATED 9-21-70.
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS 2 CHAINS NORTH OF A SMALL DRAW RUNNING NORTHEAST.

FD. ROTTED REMAINS AT RECORD
 REC. A 15" SPRUCE BEARS N78 1/2"E, 7.9'(BLM 1970)
 FD. ROTTED REMAINS AT RECORD
 REC. A 6" SPRUCE BEARS S64 1/4"W, 23.8'(BLM 1970)
 A 10" DOUGLAS FIR BEARS N85 1/2"W, 7.3'-SBT
 "1/4 S28 BT"
 AN 8" DOUGLAS FIR BEARS N36"E, 28.1'-SBT
 "1/4 S27 BT"

T22N R12E CORNER NO. 50
S28|S27
S33|S34
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A STEEP ROCKY NORTH SLOPE, 275'± SOUTH OF FRAZIER CREEK.

A 13" FIR BEARS S26 1/2"W, 40.9'-SBT
 "T22N R12E S33 BT"
 A 6" DOUGLAS FIR BEARS N56"W, 17.0'-SBT
 "T22N R12E S28 BT"
 A 7" DOUGLAS FIR BEARS N34"E, 37.4'-SBT
 "T22N R12E S27 BT"

T22N R12E CORNER NO. 51
 $\frac{1}{4}$
S27
S34
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A STEEP NORTHEAST SLOPE. RIDGE TOP IS 100'± WEST OF CORNER.

A 9" CEDAR BEARS N70"E, 12.7'-SBT
 "1/4 S27 BT"
 A 5" CEDAR BEARS S49"E, 7.4'-SBT
 "X BT"

T22N R12E CORNER NO. 52
 $\frac{1}{4}$
S27
S34
LS 3966
1993

SET 3 1/4" USFS CAP ON A #5 REBAR BELOW PAVEMENT.
 CORNER FALLS IN A PAVED ROAD 3' EAST OF CENTERLINE.

A 12" CEDAR BEARS N38 1/2"W, 28.9'-SBT
 "E1/16 S27 BT"
 A 10" DOUGLAS FIR BEARS S22"W, 31.6'-SBT
 "E1/16 S34 BT"

T22N R12E CORNER NO. 53
S27|S26
S34|S35
LS 3966
1993

FD. A 3/4" PIPE WITH PLUG - RCE 11173.
 SET STD USFS MONUMENT IN A MOUND OF STONE. LAID PIPE ALONGSIDE.

FD. A 30" DOUGLAS FIR BEARS N34 1/2"W, 67.3'-VS
 REC. A 12" SPRUCE BEARS N34 1/2"W, 67.3 (GLO 1872)
 FD. ROTTED YELLOW PINE STUMP AT RECORD
 REC. A 23" PITCH PINE 8 N75 1/2"E, 42.9' (GLO 1872)
 FD. ROTTED YELLOW PINE STUMP AT RECORD
 REC. AN 8" PITCH PINE BEARS S56 1/2"E, 44.2' (GLO 1872)
 FD. ROTTED, DOWN AND DEAD PINE AT RECORD-VS
 REC. A 23" PITCH PINE BEARS S66 1/4"W, 49.5' (GLO 1872)
 ** A 14" YELLOW PINE BEARS N67"E, 8.7'-SBT
 "T22N R12E S26 BT"
 AN 11" CEDAR BEARS S 27 1/4"E, 45.5'-SBT
 "T22N R12E S35 BT"
 ** A 12" YELLOW PINE BEARS S33 1/4"W, 19.3'-SBT
 "T22N R12E S34 BT"

** INDICATES TREE SHOWN ON 4 R/S 8 FOUND TAGGED BUT NOT SCRIBED

NE 1/16
+ S34
LS 3966
1993

CORNER NO. 54
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A FLAT IN REPRODUCTION TIMBER.

AN 8" CEDAR BEARS N89"W, 14.7'-SBT
 "NE 1/16 S34 BT"
 A 6" DOUGLAS FIR BEARS N18 1/4"W, 5.5'-SBT
 "NE 1/16 S34 BT"

N 1/16
S34|S35
LS 3966
1993

CORNER NO. 55
 FD. A 1 1/2" CAP ON REBAR IN A MOUND OF STONE. SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A FLAT IN TIMBER. DRAW RUNS NORTHEAST 50'± NORTH OF CORNER.

A 12" YELLOW PINE BEARS S26"E, 9.6'-SBT
 "N 1/16 S35 BT"
 A 17" CEDAR BEARS S82"W, 17.1'-SBT
 "N 1/16 S34 BT"

T22N R12E CORNER NO. 56
 $\frac{1}{4}$
S33|S34
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A SKID ROAD ON A NORTHEAST SLOPE 40'± SOUTH OF AN EAST WEST DRAW.

A 16" WHITE FIR BEARS S45 1/2"E, 19.2'-SBT
 "1/4 S34 BT"
 A 5" CEDAR BEARS S60"W, 56.1'-SBT
 "X BT"

T22N R12E CORNER NO. 57
 $\frac{1}{4}$
S34|S35
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS AT THE BASE OF A NORTH SLOPE AND 120'± SOUTH OF A CREEK.

A 14" DOUGLAS FIR BEARS N78 1/2"W, 4.6'-SBT
 "1/4 S34 BT"
 A 9" CEDAR BEARS S42 1/2"E, 14.1'-SBT
 "1/4 S35 BT"

T22N R12E CORNER NO. 58
S33|S34
S4|S3
T21N
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A STEEP NORTHEAST SLOPE IN DENSE BRUSH.

A 15" WHITE FIR BEARS N38 1/2"E, 29.2'-SBT
 "T22N R12E S34 BT"
 AN 8" WHITE FIR BEARS S47 3/4"E, 25.7'-SBT
 "T21N R12E S3 BT"
 A 13" WHITE FIR BEARS S31"W, 13.2'-SBT
 "T21N R12E S4 BT"
 A 5" WHITE FIR BEARS N34 1/2"W, 25.3'-SBT
 "X BT"

T22N R12E CORNER NO. 59
 $\frac{1}{4}$
S34
S2
T21N
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A SEMI STEEP EAST SLOPE. MAIN ROAD 490'± EAST.

AN 11" SUGAR PINE BEARS N26"E, 18.2'-SBT
 "1/4 S34 BT"
 A 7" WHITE FIR BEARS S64"E, 19.4'-SBT
 "1/4 S3 BT"

CORNER NOTES

H.B. = HEALED BLAZE
 V.S. = VISIBLE SCRIBING
 S.B.T. = SCRIBED AS A BEARING TREE
 STD USFS MON. = 3 1/4" ALUMINUM CAP ON A 5/8" STEEL ROD

T22N R12E CORNER NO. 60
S34|S35
S3|S2
T21N
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTHEAST SLOPE 75'± SOUTH OF AN OLD ROAD.

A 13" DOUGLAS FIR BEARS N48 1/2"W, 10.8'-SBT
 "T22N R12E S34 BT"
 A 9" DOUGLAS FIR BEARS N72 1/2"E, 7.7'-SBT
 "T22N R12E S35 BT"
 A 14" SUGAR PINE BEARS S18 1/4"E, 25.9'-SBT
 "T21N R12E S2 BT"
 AN 8" CEDAR BEARS S23"W, 20.6'-SBT
 "T21N R12E S3 BT"

T22N R12E CORNER NO. 61
 $\frac{1}{4}$
S35
S2
T21N
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS 300'± NORTH OF A ROAD ON A NORTH-WEST SLOPE.

A 10" WHITE FIR BEARS S33 1/2"W, 13.2'-SBT
 "1/4 S2 BT"
 A 10" WHITE FIR BEARS N43"W, 19.8'-SBT
 "1/4 S35 BT"

T22N R12E CORNER NO. 63
 $\frac{1}{4}$
S3
C
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTHEAST SLOPE IN BRUSH AND TREES.

A 10" WHITE FIR BEARS S50 3/4"W, 9.6'-SBT
 "CN 1/16 S3 BT"
 AN 8" WHITE FIR BEARS S25 1/2"E, 1.9'-SBT
 "X BT"

N 1/16
S3|S2
LS 3966
1993

CORNER NO. 64
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTH SLOPE, 400'± EAST OF A ROAD.

A 13" DOUGLAS FIR BEARS S86 3/4"E, 17.1'-SBT
 "N 1/16 S2 BT"
 A 7" CEDAR BEARS N49 1/2"W, 8.9'-SBT
 "N 1/16 S3 BT"

N 1/16
C
S2
LS 3966
1993

CORNER NO. 65
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTH SLOPE, 300'± WEST OF A ROAD.

A 10" SUGAR PINE BEARS N85 1/2"E, 14.2'-SBT
 "CN 1/16 S2 BT"
 A 7" DOUGLAS FIR BEARS S10"E, 10.6'-SBT
 "CN 1/16 S2 BT"

T21N R12E CORNER NO. 66
 $\frac{1}{4}$
S4|S3
LS 3966
1993

FD. LARGE EMBEDDED MOUND OF STONE. SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A GENTLE NORTHEAST SLOPE IN HEAVY REGROWTH.

FD. OLD STUMP DEPRESSION AT RECORD
 REC 24" FIR BEARS N62"E, 13.2' (GLO 1878)
 A 10" RED FIR BEARS S20"W, 11.5'-SBT
 "1/4 S4 BT"
 A 12" RED FIR BEARS S89"E, 4.6'-SBT
 "1/4 S3 BT"

T21N R12E CORNER NO. 67
 $\frac{1}{4}$
S3|S2
LS 3966
1993

FD. 1 1/4" PIPE IN A MOUND OF STONE. SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTHEAST SLOPE, 300'± SOUTHWEST OF A ROAD.

FD. A 23" WHITE FIR BEARS N82 1/4"E, 29.4'-HB
 REC. A 17" WHITE FIR BEARS N83 1/2"E, 30.03'(4 RS 8)
 FD. A 13" WHITE FIR BEARS S37 1/2"W, 28.8'-HB
 REC. A 6" WHITE FIR BEARS S39"W, 29.71'(4 RS 8)
 FD. A 69" STUMP BEARS S40 3/4"E, 49.0'
 REC. A 70" SUGAR PINE BEARS S34"E, 46.9' (GLO 1877)
 FD. A BURNED SNAG N20 1/2"W, 18.3'
 REC. A 68" SUGAR PINE BEARS N34"W, 12.5' (GLO 1877)

T21N R12E CORNER NO. 68
 $\frac{1}{4}$
S2
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A SOUTH SLOPE, 250'± WEST OF A ROAD AND 200'± NORTH OF A ROAD.

A 5" WHITE FIR BEARS N72"W, 5.1'-SBT
 "C 1/4 S2 BT"
 AN 8" DOUGLAS FIR BEARS N50 1/4"E, 50.8'-SBT
 "C 1/4 S2 BT"

E 1/16
C-S2
LS 3966
1993

CORNER NO. 69
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A GENTLE NORTH SLOPE. OLD SKID ROAD BEARS 50'± NORTH.

AN 11" WHITE FIR BEARS S33 3/4"W, 27.5'-SBT
 "CE 1/16 S2 BT"
 A 6" WHITE FIR BEARS N82 1/2"E, 12.2'-SBT
 "CE 1/16 S2 BT"

T21N R12E CORNER NO. 70
 $\frac{1}{4}$
S2|S1
LS 5623
1989

FD. A 3 1/4" USFS ALUMINUM CAP ON A ROD IN A MOUND OF STONE. CORNER FALLS ON A STEEP NORTHWEST SLOPE, 20'± WEST OF A NORTH-SOUTH ROAD.

FD. A 6" WHITE FIR BEARS S64 3/4"W, 4.4'-VS
 REC. A FIR BEARS S64' 43"W, 4.4' (9 RS 107)
 FD. A 16" DOUGLAS FIR BEARS S49 3/4"E, 3.5'-VS
 REC. A FIR BEARS S49' 49"E, 3.5' (9 RS 107)

SE 1/16
+ S2
LS 3966
1993

CORNER NO. 71
 SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A GENTLE NORTHEAST SLOPE, 90'± NORTH OF A MAIN ROAD.

A 7" WHITE FIR BEARS S76"E, 23.3'-SBT
 "SE 1/16 S2 BT"
 AN 8" WHITE FIR BEARS N52"E, 32.3'-SBT
 "SE 1/16 S2 BT"

T21N R12E CORNER NO. 72
 $\frac{1}{4}$
S2-S1
LS 5623
1989

FD. 3 1/4" USFS ALUMINUM MONUMENT IN A MOUND OF STONE. CORNER FALLS ON A STEEP NORTH SLOPE IN HEAVY BRUSH, 250'± NORTH OF A ROAD.

AN 11" WHITE FIR BEARS N86 1/2"E, 34.3'-VS
 REC. A 10" WHITE FIR BEARS N87'03"E, 34.3' (9 RS 107)
 A 15" WHITE FIR BEARS N78 1/4"E, 13.7'-VS
 REC. A 14" WHITE FIR BEARS N77'58"E, 13.5' (9 RS 107)

T21N R12E CORNER NO. 73
 $\frac{1}{4}$
S3
S10
LS 3966
1993

SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A NORTHEAST SLOPE, APPROXIMATELY N70'E, 1300' FROM MILL PEAK LOOKOUT.

FD. A 22" WHITE FIR BEARS N30"E, 4.5'-HB
 REC. A 20" WHITE FIR BEARS N31"E, 4.0 (USFS CORNER RECORD - FILE No. E-17)
 AN 18" WHITE FIR BEARS S66"W, 61.5'-SBT
 "1/4 S10 BT"

T21N R12E CORNER NO. 74
S3|S2
S10|S11
LS 3966
1993

FD. A 1 1/4" PIPE IN A MOUND OF STONE. SET STD USFS MONUMENT IN A MOUND OF STONE CORNER FALLS ON A SLIGHT NORTHEAST SLOPE, 60'± SOUTHWEST OF A LOG DECK.


FD. A 13" WHITE FIR BEARS S56"W, 3.5' HB
 REC. A 10" WHITE FIR BEARS S55"W, 3.18 (4 RS 8)
 FD. A 12" RED FIR BEARS N40"E, 7.1'-HB
 REC. A 6" RED FIR BEARS N43"E, 7.34 (4 RS 8)
 A 13" RED FIR BEARS N42 3/4"W, 23.1'-SBT
 "T21N R12E S3 BT"
 A 12" RED FIR BEARS S20"E, 40.6' -SBT
 "T21N R12E S11 BT"

RECORD OF SURVEY

FOR
 USDA FOREST SERVICE

"EASTSIDE '92"

IN SECTIONS 1, 12, AND 21 OF T 24 N, R 8 E,
 IN SEC 31 OF T 25 N, R 8 E,
 IN SECTIONS 31, 32, 33 AND 34, T 22 N, R 12 E,
 AND IN SECTIONS 1, 2, 3 AND 4, T 21 N, R 12 E, MDM
 IN THE UNINCORPORATED AREA OF PLUMAS
 COUNTY, STATE OF CALIFORNIA

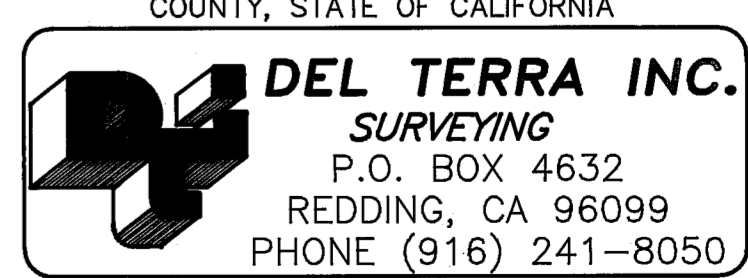

DATE: MARCH, 1994
 SHEET: 8 OF 9