


## Corner Notes:

Corner Key	Cap Markings	Corner Key	Cap Markings		
①	T23 R11E S5 S4 S8 S9 LS 2843 1992	Found USFS Standard Aluminum Cap per 9 RS 80 bearing trees with Bearing Tree tags 21" Stump S77°30'E, 41.5 lks. 23" Sugar Pine N03°E, 53.0 lks.	⑨	Found 5/8" rebar with Aluminum Cap per 9 RS 131 6" Cotton Wood with bearing tree tag N87°05'W, 7.0'	
②	T23N R11E 1/4 8 9 LS 2843 1992	Found USFS Standard Aluminum Cap per 9 RS 80 bearing trees and tags. 28" Blazed & Scribed Pine S69°30'E, 101.0' 39" Fir S27°40'E, 68.9' 14" Blazed & Scribed Cedar S4°57'W, 76.4' Burned stump S67°18'E, 118.0'	⑩	Set 5/8" rebar with Aluminum Cap at record position per 10 RS 21, Corner was destroyed by fill set bearing tags on 12" Pine N4°47'W, 294.4' 8" Pine S30°50'E, 126.7' 30" Fir with K-tag N46°00'E, 246.3' per 9 RS 131	
③	T23N R11E 8 9 17 16 LS 2843 1992	Found USFS Standard Aluminum Cap per 9 RS 80 bearing trees 20" Pine N86°36'E 70.3' 21" Blazed & Scribed Pine Snag S56°27'E, 88.0" 13" Blazed & Scribed Fir S14°01'E 96.1. 9" Pine Blazed & Scribed N11°33'W, 19.2'	⑪	LS 3185 E 1/16 S10 S15 1973	Found 2" Brass Disk per 10 RS 21 bearing tree 20" Blazed Pine S72°18'W, 44.2'
④	T23N R11E 1/4 S4 S9 1984	Found 5/8" rebar with Aluminum Cap stamped LS 2843 per 9 RS 131 Bearing trees with Bearing Tree tags 12" Pine S10°40'E, 15.0' 16" Pine N77°46'E, 29.7'	⑫	Found Plastic Cap RCE 22836 Brown per 7 RS 56 Bearing trees with bearing tree tags 28" Blazed Cedar N14°05'W, 12.0' 13" Blazed Cedar N42°35'E, 6.0'	
⑤	T23N R11E 4 3 9 10 1984	Found B.L.M. Brass Cap Bearing trees with bearing tree tags 24" Blazed Pine S43°E, 17.0 lks. 13" Fir Blazed Fir N28°E, 34.0 lks	⑬	T23N R11E S3 S2 S10 S11 1978	Found B.L.M. Brass Cap per 7 RS 56 Bearing Trees with tags 31" Fir S20°30'W, 39.0 lks 15" Blazed Pine S74°W, 32.0 lks. 11" Pine N16°E, 58.0 lks.
⑥	T23N R11E 4 3 9 10 1984	Found B.L.M. Brass Cap per 7 RS 56 Bearing trees with bearing tree tags 6" Black Oak S55°E, 27.0 lks 15" Blazed Pine S28°45'E, 40.0 lks. 12" Blazed & Scribed Pine N42°15'W, 46.5 lks. 6" Stump N45°W, 106.0 lks. 24" Pine Blazed & Scribed N42°30'E, 79.5 lks.	⑭	Set 5/8" rebar stamped LS 2843, from which a Plastic Cap RCE 22836 Brown bears N83°24'04"E, 8.10'	
⑦	T23N R11E 9 10 16 15 LS 2843 1992	Found Plastic Cap RCE 22836 Brown, per 7 RS 56 36" Pine Stump with Bearing Tree tag S16°53'E, 13.5' Set bearing tree tag on 16" Pine N27°W, 2.8'	⑮	Found Plastic Cap RCE 22836 Brown for 1/4 Corner and witness corner per 7 RS 56 Bearing trees for 1/4 Corner 12" Blazed Fir N16°E, 1.9'(N62°W, 3.1'R3) 12" Blazed Pine S43°30'W, 5.7'(S58°W, 8.3'R3) 12" Blazed Pine S52°E, 17.35'(S60°E, 14.7'R3) Bearing trees for witness corner 30" Blazed Pine S30°W, 35.0' 24" Blazed Pine S1°30'W, 41.0 lks	
⑧	T23N R11E 9 10 16 15 LS 2843 1992	Found USFS Standard Aluminum Cap per 9 RS 80 bearing trees with bearing tree tags 20" Pine N7°27'E, 10.8' Stump remnant N73°34'E, 53.0' Stump remnant S49°55'E, 23.7' 24" Pine S17°39'W, 46.5'			

## SURVEYOR'S STATEMENT

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Professional Land Surveyor's Act at the request of Soper Wheeler Company in April, 2003.

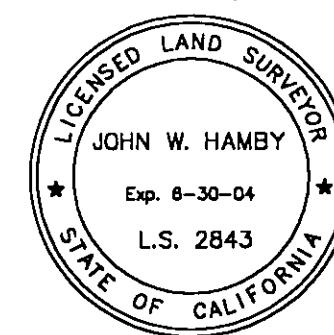

*John W. Hamby*  
John W. Hamby LS 2843

## COUNTY SURVEYOR'S STATEMENT

This map has been examined in accordance with Section 8766 of the Professional Land Surveyor's Act this 15<sup>th</sup> day of August, 2003.



*R. Tom Hunter*  
R. Tom Hunter RCE 30515  
PLUMAS COUNTY SURVEYOR  
License Expiration Date 3/31/04

## RECORDER'S STATEMENT

Filed this 26<sup>th</sup> day of August, 2003 at 2:40 P.m. in  
Book 12 of Record of Surveys, at page 142-143, at the request  
of the County Surveyor.

Fee \$10.00  
File No. 2003-10036  
by *Deputy* *Deputy*

RECORD OF SURVEY  
for  
Soper Wheeler Company

A portion of Sections 9 and 10  
T. 23 N., R. 11 E., M.D.M.

Plumas County ~ California  
Scale 1" = 500' April, 2003

Hamby Surveying Inc.  
P.O. Box 1209  
Portola, CA 96122  
(530) 832-5571