

<p>T26N R13E R14E CORNER No. 3 FD. A 16 X 12 X 6 INCH (23 X 17 X 11 INCH)1 STONE WITH 5 NOTCHES SOUTH AND 1 NOTCH NORTH IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A MODERATE SOUTHWEST SLOPE IN A BURNED AREA, 300'± SOUTH OF A SOUTH DRAINING DRAW. FD. A LARGE BURNT JUNIPER, S64°E, 43.7' REC. A 19° JUNIPER, S61 1/2°E, 42.2' ()1 ALL TREES IN AREA ARE BURNT AND DEAD. REGROWTH PINE SURROUNDS CORNER BUT IS TOO SMALL TO MARK.</p>	<p>S¹/₁₆ S₇ CORNER No. 9 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS AT THE EDGE OF A PASTURE, 100'± FROM TREE LINE. A CABIN BEARS S25°W, 45'±. SCRIBED A 25" SUGAR PINE, S82 1/2°W, 44.9' "SW 1/16 S7 BT" SCRIBED A 22" SUGAR PINE, S47 1/2°W, 98.5' "SW 1/16 S7 BT"</p>	<p>T26N R14E CORNER No. 10 S12 S₇ CORNER No. 10 FD. A STD USFS DRIVE IN MONUMENT IN A MOUND OF STONE PER ()2. CORNER FALLS ON A MODERATE NORTH SLOPE, 500'± SOUTH OF AN EAST-WEST PAVED ROAD. FD. A 17" YELLOW PINE, S67°E, 14.6' -HB REC. A 16° P. PINE, S73°29'E, 14.6' ()2 FD. AN 11" YELLOW PINE, S25 1/2°W, 30.4' -VS REC. A 12° P. PINE, S25°38'W, 30.4' ()2 SCRIBED A 17" RED FIR, N49°E, 24.7' "T26N R14E S7 BT" SCRIBED A 12" RED FIR, N69°W, 42.5' "T26N R14E S12 BT"</p>	<p>T26N R14E CORNER No. 20 S18 S₁₉ CORNER No. 20 FD. A 12 X 10 X 6 INCH ()1 CHISELED "1/4" IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A GRADUAL NORTH SLOPE, 100'± SOUTH OF A DRAINAGE IN SMALL PINES AND FIRS. SCRIBED AN 8" NOBLE FIR, N81°E, 13.6' "1/4 S18 BT" SCRIBED A 10" SUGAR PINE, S75°E, 33.1' "1/4 S19 BT"</p>
<p>T26N R14E CORNER No. 4 S₆ S₇ SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AT SINGLE PROPORTION POSITION IN A MOUND OF STONE. CORNER FALLS ON A MODERATE SOUTHEAST SLOPE, 120'± WEST OF A RAVINE. NO SUITABLE TREES AVAILABLE</p>	<p>S₁₃ S₁₈ LS 5623 1993 CORNER No. 11 FD. A 16 X 11 X 8 INCH (18 X 13 X 7 INCH)1 STONE WITH 5 NOTCHES ON THE EAST AND SOUTH SIDES IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A GENTLE SOUTH SLOPE IN A ROCKY, BURNT AREA. ORIGINAL BT'S GONE. SCRIBED A 21" PONDEROSA PINE, N20°W, 122.5' "T26N R14E S6 BT" SCRIBED A 23" PONDEROSA PINE, N39°E, 245.9' "T26N R14E S6 BT"</p>	<p>N₁/₁₆ RM S₇ S₁₈ CORNER No. 16 TRUE CORNER FALLS IN LAST CHANCE CREEK. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE FOR REFERENCE MONUMENT. R.M. FALLS IN A PASTURE, 30'± SOUTH OF THE CREEK AND BEARS S 25° 30' W, 47.8' FROM THE TRUE CORNER. CHISELED "BO" AND "X" 0.3' BELOW THE TOP OF A 4.5' X 2.5' BOULDER PROJECTING 2.5' ABOVE THE GROUND AND BEARING S6 3/4°W, 66.4' FROM THE TRUE CORNER.</p>	<p>T26N R14E CORNER No. 21 S₁₈ S₁₇ LS 3966 2001 CORNER No. 21 FD. A 24 X 18 X 16 INCH (26 X 20 X 20 INCH)1 STONE WITH 5 NOTCHES EAST AND SOUTH IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A MODERATE, ROCKY SOUTHWEST SLOPE. FD. A 30" PINE SNAG, N65°E, 91.7' REC. A 18" PINE N65°E, 91.7' ()1 FD. A 36" YELLOW PINE, S24°E, 130.7' -HB REC. A 24" PINE, S24°E, 130.7' ()1 SCRIBED A 10" JUNIPER, S45 1/2°E, 40.0' "T26N R14E S17 BT" SCRIBED AN 11" JUNIPER, S60°E, 84.6' "T26N R14E S20 BT" SCRIBED A 5" JUNIPER, S40°W, 19.9' "T26N R14E S19 BT"</p>
<p>T26N R14E CORNER No. 5 S₆ S₅ S₇ S₈ LS 3966 2001 CORNER No. 5 FD. A 16 X 11 X 8 INCH (18 X 13 X 7 INCH)1 STONE WITH 5 NOTCHES ON THE EAST AND SOUTH SIDES IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A GENTLE SOUTH SLOPE IN A ROCKY, BURNT AREA. ORIGINAL BT'S GONE. SCRIBED A 21" PONDEROSA PINE, N20°W, 122.5' "T26N R14E S6 BT" SCRIBED A 23" PONDEROSA PINE, N39°E, 245.9' "T26N R14E S6 BT"</p>	<p>W₁/₁₆ S₇ S₁₈ LS 5623 1993 CORNER No. 11 FD. A 3 1/4" ALUM. CAP ON A 5/8" ALUM. ROD PER ()2 FD. A 10" YELLOW PINE, N85°W, 39.2' -VS REC. A 9° P. PINE, N83°52'W, 39.2' ()2 FD. A 17" YELLOW PINE, S29°E, 46.8' -VS REC. A 16° P. PINE, S29°29'E, 46.8' ()2</p>	<p>T26N R14E CORNER No. 12 S₇ S₁₈ LS 5623 1993 CORNER No. 12 FD. A 3 1/4" ALUM. CAP ON A 5/8" ALUM. ROD PER ()2 FD. A 14" YELLOW PINE, S58°E, 9.5' -VS REC. A 14° P. PINE, S59°05'E, 9.5' ()2 FD. A 14" YELLOW PINE, N20°E, 39.0' -VS REC. A 14° P. PINE, N20°35'E, 39.0' ()2</p>	<p>R13E R14E CORNER No. 17 S₁₃ S₁₈ LS 3966 2001 CORNER No. 17 FD. A 17 X 12 X 11 INCH (24 X 18 X 11 INCH)1 STONE CHISELED "1/4" IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS IN THE OPEN ON A MODERATE, ROCKY SOUTHWEST SLOPE. SCRIBED A 9" JUNIPER, S35°E, 80.8' "1/4 S18 BT" SCRIBED A 6" BIFURCATED JUNIPER, S57°W, 90.5' "1/4 S13 BT"</p>
<p>T26N R14E CORNER No. 6 S₇ S₈ LS 3966 2001 CORNER No. 6 NO EVIDENCE OF ORIGINAL CORNER FOUND. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE AT PROPORTIONED POSITION. CORNER FALLS IN A FLAT COW PASTURE, 300'± SOUTH OF A ROAD AND 100'± WEST OF A CREEK. NO SUITABLE TREES AVAILABLE</p>	<p>S₁₃ S₁₈ LS 5623 1993 CORNER No. 14 FD. A 14" YELLOW PINE, S58°E, 9.5' -VS REC. A 14° P. PINE, S59°05'E, 9.5' ()2 FD. A 14" YELLOW PINE, N20°E, 39.0' -VS REC. A 14° P. PINE, N20°35'E, 39.0' ()2</p>	<p>T26N R14E CORNER No. 18 S₁₈ S₁₇ LS 3966 2001 CORNER No. 18 NO EVIDENCE FOUND. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE AT PROPORTION POSITION. CORNER FALLS ON A MODERATE NORTHERLY SLOPE IN A OPEN AREA NEAR THE INTERSECTION OF SKID ROADS IN SAGEBRUSH AND YOUNG REGROWTH. SCRIBED A 9" SUGAR PINE, S42°E, 45.4' "1/4 S17 BT"</p>	<p>T26N R14E CORNER No. 19 S₁₃ S₁₈ S₂₄ S₁₉ LS 3966 2001 CORNER No. 19 FD. A 16 X 12 X 7 INCH (22 X 15 X 9 INCH)1 STONE WITH 3 NOTCHES NORTH AND SOUTH IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE, 250'± SOUTHWEST OF THE TOP OF A NORTHWEST-SOUTHEAST RIDGE. FD. A 16" YELLOW PINE, S30°E, 39.0' -HB REC. A 6" BLACK PINE, S32 1/2°E, 38.9' ()1 FD. A DEAD, DOWN AND ROTTED PINE, N38 1/2°W, 23.1' -VS REC. A 14" PITCH PINE, N38 1/2°W, 23.1' ()1 FD. DEAD AND DOWN PINE, S70°W, 62.0' REC. A 26" PITCH PINE, S70°W, 62.0' ()1 SCRIBED A 14" JUNIPER, N18°E, 47.4' "T26N R14E S18 BT" SCRIBED A 7" JUNIPER, S43°W, 36.7' "T26N R13E S24 BT" SCRIBED A 9" JUNIPER, N75°W, 33.7' "T26N R13E S13 BT"</p>
<p>T26N R14E CORNER No. 8 S₁/₁₆ S₇ S₈ LS 3966 2001 CORNER No. 8 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS IN SCATTERED PINES AND SAGEBRUSH ON A MODERATE NORTH SLOPE DESCENDING INTO A PASTURE. SCRIBED A 23" SUGAR PINE, N75°E, 21.1' "S 1/16 S7 BT" SCRIBED A 21" SUGAR PINE, S3°W, 58.4' "S 1/16 S12 BT"</p>	<p>C N₁/₁₆ S₁₈ 2001 CORNER No. 15 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS ON A STEEP NORTHWEST SLOPE, 40'± NORTH OF A ROAD IN PINES AND FIRS. SCRIBED A 9" SUGAR PINE, S39°W, 4.6' "CN 1/16 S18 BT" SCRIBED A 15" SUGAR PINE, N57°W, 59.2' "CN 1/16 S18 BT"</p>		


RECORD OF SURVEY

FOR

USDA FOREST SERVICE
PLUMAS NATIONAL FOREST

"LAST CHANCE 1"

IN SECTIONS 7 AND 18 IN T. 26 N., R. 14 E., M.D.M., IN THE UNINCORPORATED AREA OF PLUMAS COUNTY, STATE OF CALIFORNIA

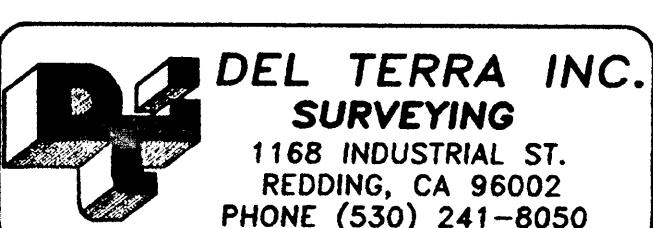

DATE: OCTOBER, 2001

SHEET 2 OF 2